







REGULATOR KIT MANUAL

Pressure Release Systems



WARNING: Abrasive blast equipment controls/deadman systems must always be supplied with full line pressure of at least 100 PSI. **NEVER** run abrasive blast equipment controls on regulated/reduced pressure!

Direction Of Air Flow →

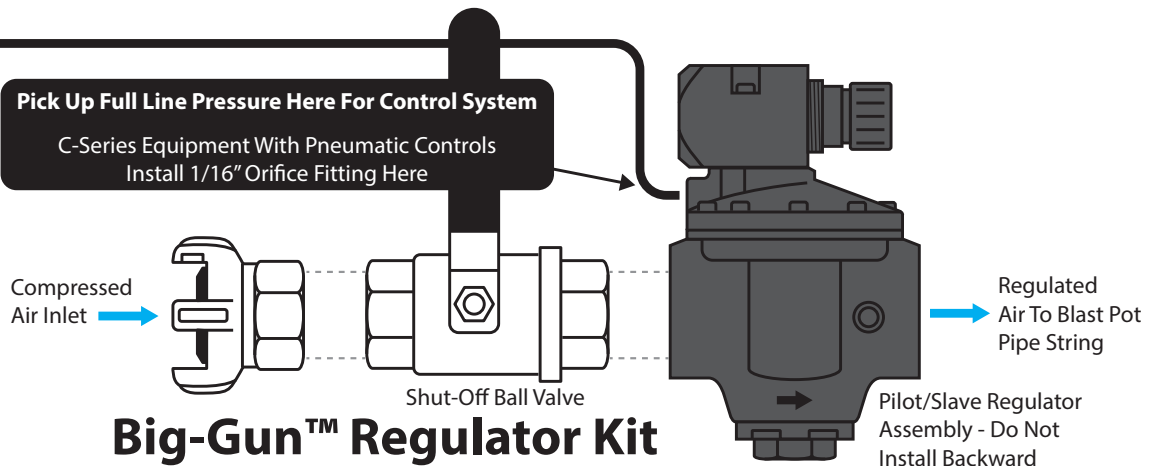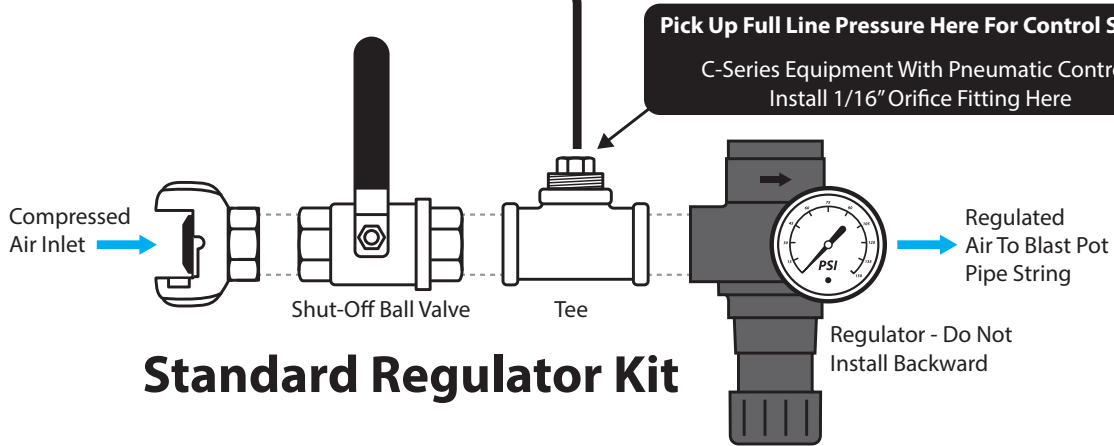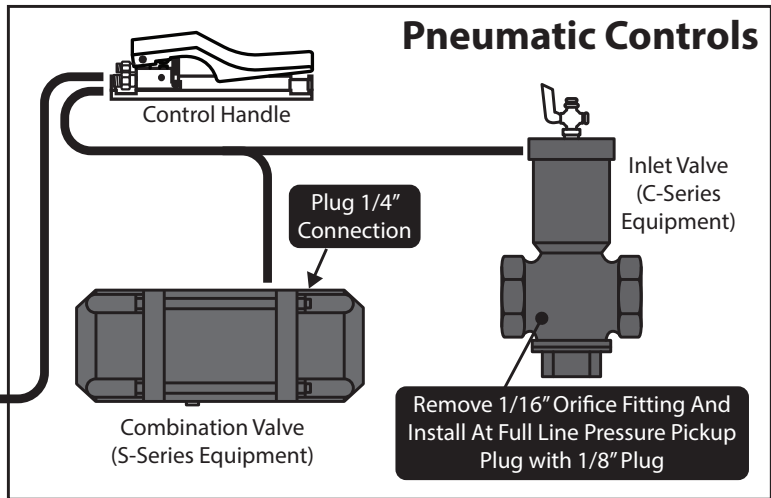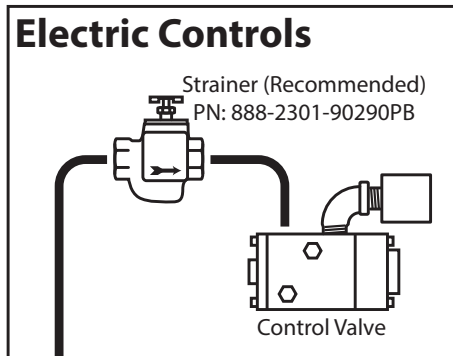



REGULATOR KIT MANUAL

Pressure Hold Systems



WARNING: Abrasive blast equipment controls/deadman systems must always be supplied with full line pressure of at least 100 PSI. **NEVER** run abrasive blast equipment controls on regulated/reduced pressure!

Direction Of Air Flow →

